



Mercedes Benz C-Class (W 203)

Failure of the front direction indicators.

If there are complaints with this vehicle that the front right or left direction indicator is not working, one possible cause is a charred contact in the direction indicator bulb holder.

To eliminate the fault, a direction indicator bulb holder including cable assembly has to be installed. To do this, proceed as follows:

- Remove the direction indicator bulb holder from the headlamp housing.
- Pull the connection plug off the headlamp.
- Remove the indicator connection lead on the vehicle side from the plug (right-hand side – pin 1 green/black cable, left-hand side – pin 1 white/black cable). Close the opening in the plug using a dummy.
- Insert the connection lead into the repair plug for the direction indicator. Connect the earth cable to the earth point on the vehicle (see photo).
- Lay the new cable harness for the indicator bulb holder and fix in place using cable ties.
- Insert the direction indicator into the headlamp housing.
- Check function.



Earth point right



Earth point left