



Mercedes Benz E-Class (W 210) Vehicles with manual gearbox

Noise coming from the area of the cardan shaft tunnel.

If there are complaints with these vehicles that buzzing noises can be heard from the area of the cardan shaft tunnel, one possible cause is vibration of the gearshift rods. At certain speeds or in certain driving conditions, the gearshift rods can vibrate so strongly that this can cause the buzzing noise complained about. For the fault to be eliminated, additional spring washers must be installed at the connection between the intermediate shifting lever and the gearshift rods.

Bulletin

