



Mercedes Benz Model W 129, 140, as of 01.12.96 Model W 170, 202, as of 01.06.97 Model W 208, 210, as of 01.02.97 All with Brake Assistant (BAS)

Engine will not start

If the above complaint is received, the cause could be moisture/corrosion in the plug connection or in the Brake Assist control unit. It is also possible for the engine to go into limp-home mode. Moreover, various diagnostic fault codes may be stored. B 1040, B 1041, B 1043, C 1020, C 1022, C 1025, C 1031, P 0603, P 1606, P 1221, P 1630, P 1747, 132 EGS, 135 EGS.

In such cases proceed as follows:

- Check plug connection 16a (CAN power supply) on the BAS control unit for moisture and corrosion and, if necessary, remove such moisture and corrosion
- If the fault is still present, the BAS control unit must be replaced.

Component arrangement:
BAS control unit in W 208

