



## **Mercedes Benz Type 170, 202, 203, 208 with 111 engine Type 202 with 605 and 611 engine**

### **ABS warning light illuminates**

If there are complaints about the above-mentioned fault, the ESP control unit could be the cause of the problem. Lack of voltage supply to the ESP control unit leads to the ABS warning light illuminating and the fault message ABS/BAS/ESP being indicated in the multi-function display. The fault codes C 1000-128 or C 1000-016 are stored in the fault memory.

- Check the voltage supply at pin 45 and pin 47 of the ESP control unit
- In addition, the fuses F 23/1f8 and F 23/1f9 should be checked for continuity and to make sure that they are fitted securely
- X12/3, check cable connector terminal 30