



## Mercedes-Benz A-Class (W168)


### Intermittent failure of electrical systems.

If some electrical systems (central locking, indicator, hazard warning indicator and power windows) have an intermittent failure, a possible cause could be a failing contact in the fuse box. To rectify the problem consider the following steps:

- Open the fuse box in the right front foot well (picture 1).
- Pull off fuse № 30 (7,5 A / picture 2)
- Check the fuse for corrosion on the contact face.
- Put a new fuse in socket 30, ensure that the resistance of the fuse bracket is sufficient.
- Pull out the new fuse and check the contact face again. There must be score marks from the fuse brackets.
- Refit the fuse and check all systems for correct function.



Picture 1  
Fuse box

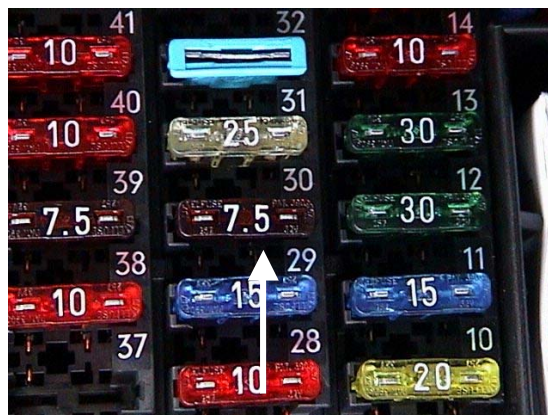

Picture 2  
Fuse 30