



## Mercedes C-Class (203)

### Software fault in the control panel affects operation of the recirculating air / fresh air function

In the case of the above vehicles equipped with climate control air conditioning, it is possible for the recirculating air flap to malfunction. In this event, when the setting for recirculating air is selected, fresh air is drawn in, and vice versa. Correct operation can be restored by using the control panel to carry out a relearning process for the servomotors. To do this, proceed as follows:

1. Switch on the ignition
2. Press the "recirculating air" and "defrost" buttons at the same time (see illustration)
3. Both LED's for the respective buttons should start to flash
4. Wait until only the LED for the "defrost" button remains on (this indicates that the learning process has been completed)
5. Switch off the ignition and remove the key
6. After waiting for at least 40 seconds start the engine

The flap control should now be checked again and should now be working properly.

