



Mercedes Benz C-Class (W202)

Faulty tank display function

If there are complaints about the above-mentioned fault, a worn or interrupted electrical cable could be the cause, in this case the cable to the left-hand sensor of the tank display. The faulty spot is near the cover on the underside of the tank.

In this case proceed as follows:

- Remove the cover on the left-hand tank sensor and check the cable.
- If the cable is damaged, the rear seat bench has to be removed.
- Expose the cable under the carpet by loosening the adhesive tape.
- Separate the cable at the faulty spot.
- Strip the cable ends by approx. 10mm and connect using a CWT solder muff (part no. 8KW 744 888-003). Pull the cable slightly to compensate the shortened length.
- Check that the rubber bush at the cable duct to the interior is fitted properly and correct if necessary.
- Fix the cable back in place with new adhesive tape.
- Replace the rear seat bench.

Bulletin