



## Mercedes Benz C-Class (W203)

### Brief sporadic illumination of the headlights

If there are complaints about the above-mentioned fault, the cause could be a malfunction in the control unit signal recording and control module (SAM). In order to eliminate the fault, proceed as follows:

#### First, carry out a reset on the control unit (N10/2).

- Remove the dust-filter housing. The dust-filter housing is located under the bonnet, front right
- Undo the snap fastenings (see Fig. 1, Point 1) and take out the dust-filter housing (see Fig. 1, Point 2).
- Disconnect the earth terminal from the battery and leave it disconnected for 15 minutes (see Fig. 2).
- After that, refasten the terminal to the earth pole.
- Check the operation of the headlights. To do this, carry out a test drive during darkness.

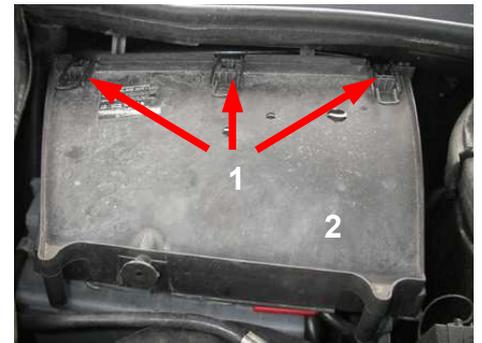


Fig. 1

If the fault has not been eliminated, basic programming of the SAM must be carried out. If this measure does not solve the problem either, the SAM must be replaced. The control unit is located on the left-hand side of the boot.



Fig. 2