



Mercedes Benz C-Class (W203, W215) WDB203.### #A, from 254312 WDB203.### #F, from 191414 ADB203.### #R, from 042818 WDB215.### #A, from 022581

Damp fog lights

If there are complaints about the above-mentioned fault, the cause could be insufficient ventilation of the light. The first generation of the lights was equipped with only one ventilation opening. During long drives in rain or when the air is very humid (cold seasons), excessively heavy fogging builds up in the lights. This is evident from a coating on the inside of the cover lens. Under normal conditions however, this fogging disappears when the lights are switched on, some time later. If the fogging is nevertheless so heavy that the droplets form and condensation builds up in the bottom of the light, it can be assumed in this case that the ventilation is not sufficient. Consequently, a modified light with two ventilation openings must be fitted.