Bulletin



© Hella KGaA Hueck & Co., Lippstadt

8. Oktober 2003

Mercedes-Benz E-Class (W210) From 01.10.1997

Bulb failure

Should there be complaints about the above-mentioned fault, the reason could be the wire to the light module. A special repair set is being offered by the supplier.

In this case proceed as follows:

- Switch off lighting and ignition
- Remove air filter box
- Remove small washing water tank
- Remove headlamp covers on both sides
- Remove wiring harness from the headlamps
- Replace H7 bubs (included in the set)
- Release the catch on the parking light sockets and remove them
- Remove the bulbs from the sockets
- Separate the parking light sockets from the wire by releasing the locating lugs
- Connect new bulb socket to the wire
- Insert the new bulbs (included in the set) in the sockets, then insert the sockets in the headlamps again and lock these in place
- Connect the adapter cable to the headlamp wiring harness and then connect to the headlamp
- Re-assemble the parts in the reverse order
- Carry out a functional test



