



Mercedes **Type: 170, 202, 208, 210**

Fog lamps not working

In the case of the above-mentioned vehicles, fog lamp failure may occur due to contact difficulties.

A lack of contact pressure at the earth connection of the connection coupling to the H1 bulb may lead to the connection coupling charring. This then often leads to the fog lamps failing. There is a special repair cable available from Mercedes for such cases. Here, the connector coupling is replaced using solder connectors (e.g. Hella CWT solder muffs).

Recommendation: Replace the bulb at the same time. Various H1 versions can be found in the Hella Lighting catalogue.