



## **Mercedes Type: 203**

### **Exterior lighting and/or stop light switch on of their own accord**

Water penetrating the module box (photo, engine compartment - left) can lead to problems with the signal recording and control module (SAM, N10/1). These problems are noticed by the fact that the exterior lighting and/or stop light switch on of their own accord. To resolve the problem proceed as follows:

- Take the lid off the module box and remove water residues
- Loosen the wiring harnesses from the module box
- Check the module box, leads and control units for water residues and dry if necessary
- Wrap about 10 cm of insulating tape around the wiring harnesses, and insert the wiring harnesses into the cable grommets again
- Fix the wiring harnesses with cable ties and
- Refit the lid of the module box

