Bulletin



© Hella KGaA Hueck & Co., Lippstadt

7. September 2004

4.4

Mercedes Type: 220 + 215 Model year: 2000 + 2001 With xenon or Bi-Xenon headlamps

Error message in instrument cluster - "Check dipped beam left/right"

With some of the above-mentioned vehicles error messages ("Check left dipped beam; Check right dipped beam") appear in the instrument cluster although the dipped beam is OK. Vehicles built since 01.06.2000 are affected. If fault B1630 is stored in the control unit (SAM) and the dipped beam is OK, a read out of the part number and the software status of the control unit should be taken. The software of the left-hand SAM (right-hand dipped beam) is OK from part number A0295450432 and software status SW14/01 onwards. The software of the right-hand SAM (left-hand dipped beam) is OK from part no. A0315451732 and software status SW20/01 onwards. If a different control unit or a control unit with an older software status is installed, it may be necessary to replace these completely.



