




## Mercedes Benz Vito (Type 638)

### Stoplight not working

If there are complaints about the above-mentioned fault, an incorrectly set stoplight switch could be the possible cause.

In this case proceed as follows:

- Remove the cover under the steering wheel (footwell).
- Press the brake pedal.
- Pull the stoplight switch operating pin out fully.
- The correct operating pin path is now set automatically.
- Check function.
- Refit the cover.

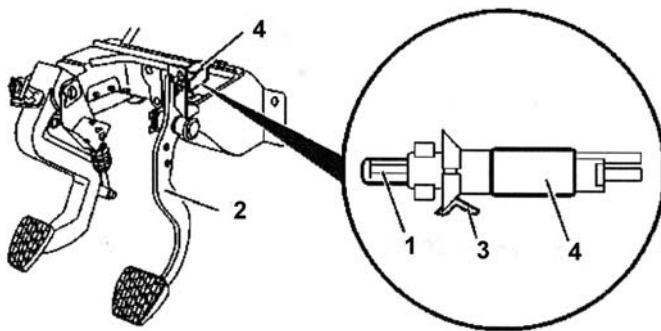

- 1 Operating pin
- 2 Brake pedal
- 3 Stoplight switch fixing
- 4 Stoplight switch