



Mercedes Benz W 210 with engine 111.942/970 and 104.995

All displays and warning lamps flicker, engine judders or cuts out

If there are complaints about the above-mentioned fault, a blown fuse could be the cause. Temporary overload of fuse F7 (instrument panel, air conditioning/heating) in fuse and relay box 1 (engine compartment, left-hand side) leads to the fuse blowing. In this case a new fuse (20A) has to be fitted.

Bulletin

