



Opel Agila model year 2001-2003 with engines Z10XE | Z12XE

Poor engine performance, engine judders

If there are complaints about the above-mentioned fault, the reason could be a faulty mass air flow meter. In addition, the fault code P0170 (fault in carburetion) is stored. Fog is suctioned in through the suction system and destroys the sensor membrane of the mass air flow meter. In this case the mass air flow meter has to be replaced and an additional seal installed under the bonnet.

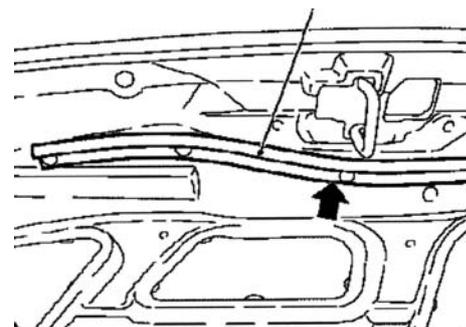


Fig. 1

- Replace the mass air flow meter.
- Loosen the seal from the bonnet up to the third fastening clip and cut it off (see Fig. 1).
- Attach the new seal to the bonnet using the two fastening clips (see Fig. 2). Make sure that the adhesive surface of the seal is pressed evenly onto the bonnet.
- Delete the fault memory.

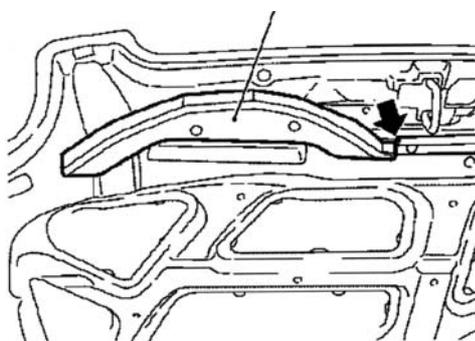


Fig. 2