Bulletin



© Hella KGaA Hueck & Co., Lippstadt

9. Juni 2005

2005 1-1

Opel Astra-F/G, Vectra B, Calibra, Omega B with engine: C18XE, C18XEL, X20XEV

Engine warning light comes on and fault code P0340 is stored in the control unit.

If there are complaints with these vehicles that the engine warning light comes on and the fault code P0340 (camshaft position sensor wire harness) is stored in the control unit, one possible cause can be a poor connection between the camshaft sensor and the connector plug. To eliminate the fault the camshaft sensor and the connector plug have to be renewed.

The Hella part number for the repair set (sensor and connector plug) is: 6PU 009 121-311.





