



## ***Opel Astra G up to model year 2001 Diesel, code letters: Y17DT, Y17DTL***

### **Engine warning light illuminates**

If the engine warning light illuminates on the above vehicles, and the code P1651 (fuel injection pump control unit, CAN-data bus failure) is stored in the fault memory, this may be caused by incorrect communication between the engine control unit and the fuel injection pump control unit.

In the case of a complaint, the power supply and the earth supply for the control units must be checked, and the fault memory must be erased. In the event of a repeat occurrence, the engine control unit must be reprogrammed. In extremely rare cases a faulty control unit may be the cause.

**Bulletin**

