



## **Opel Astra G, Corsa C, Combo C, Meriva With engine Y17DT and Y17DTL**

### **Engine will not start, or cuts out.**

If there are complaints with these vehicles that the engine will not start, or that it cuts out, one possible cause is the injection-pump control unit. The fault code P0251 (injection-volume dosage) may be stored in the fault memory. A further fault which may be found is that no fuel arrives at the injection lines. When troubleshooting, the entire periphery (wiring, plugs, etc.) of the control unit should be checked. If no fault can be found here, the fault lies in the control unit. The control unit is fitted behind the engine. It has only one plug-connection and has a warning label.

#### Note:

Before replacing the injection-pump control unit, it should be opened and checked for "dry" soldering joints. Often, the cause of the failure is a defective soldering joint. If such a soldering joint can be discerned clearly, it can be resoldered.