



## **Opel Astra G, Zafira All Models from 2000 - 2002**

### **Chattering Noises from Area of Steering Column**

If a chattering noise from the area of the steering column is the subject of complaint on these vehicles, the possible cause is the airbag contact unit. The noise results from the flasher switch is actuated and the steering wheel turned. The flasher switch hits against a plastic ridge formed when the contact unit was produced when the indicators are switched on the steering wheel is turned.

To eliminate this noise, replace the airbag contact unit. Replacement of the flasher switch does not eliminate the problem.

**Blitz-Info**

