



OPEL

Astra-H, Zafira-B, Vectra-C, Motor code Z19DT, Z19DTH, Z19DTJ, Z19DTL

**Vehicles from year of manufacture 2004 with diesel particulate
filter**

**Vehicles has loss of power
Engine control lamp is lit up
Fault code: P1901, P0234, P242F**

Problem:

Fault code P1901 is displayed simultaneously with P0234 and P242F.

Possible cause:

defect on charge pressure control valve.

Splashwater accesses the valve via the vent.

The can lead to internal corrosion and hence to the failure of the charge pressure control valve.

Solution of the problem:

Check the valve and replace if necessary. Also protect the charge pressure control valve against further splashwater. The vehicle manufacturer offers a special plastic cover for the front bumper of the Zafira-B.

Delete the fault memory after renewal of the charge pressure control valve. Subsequently perform a particulate filter regeneration.