



Bulletin

Opel Astra J Model year 2010–2011 All models

Flickering stop light Electric parking brake control lamp illuminates Error code C0277

If the above fault occurs together with error code C0277, this may be associated with a defective brake pedal position sensor. Issues with the calibration of the sensor may occur. In this case, the sensor must be checked and replaced if necessary.

Note

The vehicle manufacturer has already installed improved sensors from the following vehicle identification number:
W0LPD6ED6B8013601 plant: Ellesmere Port
W0LPE6EF2BG024146 plant: Gleiwitz
XUFPE6DC3B3000882 plant: St. Petersburg