



## *Opel Astra-G 98 - 2000* *Zafira 99 - 2000*

Leak between the lens and housing of the headlamp.

If the problem is dew in the headlamp, on the above mentioned vehicle, the fault can be attributed to a too small gap between the bonnet and headlamp (Pic.1), this causes the bonnet to knock or press onto the headlamp and it becomes damaged.


To rectify the problem one or both faulty headlamps must be renewed. Additionally the following work must be carried out:

1. Readjust the bonnet latch. To do this, open the bonnet and measure the distance between the bonnet panel and the disc of the bonnet catch (Pic.2). The new setting is the old setting + 1,0 – 1,5mm.
2. Screw out the bonnet height control rubber (snubber) ¼ of a turn (Pic.3).

Check the newly adjusted gap between the bonnet and the rubber seal of the headlamp. Use a 0,5 mm thickness gauge. It must slide through the gap without any resistance.



Picture 1

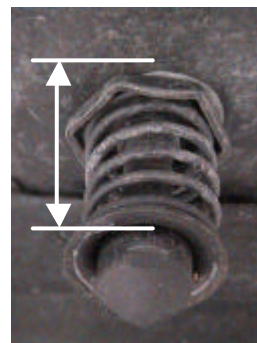

Picture2



Picture3

Bulletin