Bulletin



© Hella KGaA Hueck & Co., Lippstadt 3 May 2007 1-1

Opel Combo from model year 10/2001 Corsa C from model year 09/2000

ABS warning lamp illuminates.

If there are complaints with these vehicles that the ABS warning lamp illuminates, one possible cause is an incorrect signal from the front ABS sensor(s). The fault speed sensor front right/left no/incorrect signal / interruption may be stored in the fault memory of the ABS control unit. This fault is caused by the right or left fastening clamp of the axle boot being loose. This clamp slips between the ABS sensor and the sensor wheel. This means that it is not possible to generate a speed signal. In order to eliminate the fault, the clamp must be fastened again. Grease that has escaped from the axle boot must be removed. If a large quantity of grease has escaped from the axle boot, new grease should be added.

Finally, the fault memory must be deleted and a functional test carried out.



