



Opel Corsa C from model year 2002 Astra G from model year 2001 with Z16SE engine

Engine jolts during driving, engine stalls due to poor idling, start-up problems.

If there are complaints about the above-mentioned faults with these vehicles, the possible cause is a faulty contact in the plug-type connection of the coolant temperature sensor.

To rectify the fault, both the coolant temperature sensor and the sensor plug have to be replaced. Proceed as follows:

- Remove the plug from the sensor and cut it off using side cutters.
- Connect a new cable harness (plug and cable) with the vehicle harness (ensure make sure of the correct).
- Replace coolant temperature sensor.
- Insert the plug and route the cable correctly.

Important note:

Due to the gold contacts on the coolant temperature sensor, it is essential that the contacts in the plug are also gold-plated.