



Opel Corsa-B manufact. year 93-95

Independent change of the ventilation on recirculation mode

If the above mentioned fault is queried, the cause could be the control wire of the recirculation flap. Under certain circumstances the control wire of the recirculation-/ fresh air function is too short, so that the control wire can work loose under load (Pressing the control button in the dashboard) from the fastening of the flap. Due to this the flap change the position independently on recirculation mode.

In this case proceed as follows:

- Remove the glovebox
- Dismantle the control cable of the recirculation flap from the blower housing.
- Unhook the control cable from the fastening of the flap
- Through bend open the fastening eye, prolonging the control cable by 3 mm
- Insert and fasten the control cable again
- Check the function of the flap
- Install the glovebox again

Bulletin