



Opel Corsa-B

Fuse № 19 blows during steering.

If the complaint on this vehicle is, that during steering, the fuse № 19 blows and the airbag light illuminates for a short time, a possible cause could be that the steering shaft squashes the wiring harness for the airbag system. Due to this a short circuit occurs and causes the above mentioned fault. Additionally the fault code 49 is stored.

To rectify the problem consider the following steps:

- Remove the lower instrument trim panel.
- Repair the faulty wiring harness and reroute it to prevent any new damage.
- Refit the lower instrument trim panel.
- Erase the fault code memory.
- Check that the airbag light goes off and the fuse № 19 doesn't blow.

If the fuse blows again, the following system checks must be carried out with the manufacturer test instructions and vehicle specific wiring diagrams.