BULLETIN



Opel Corsa D

Model year: 2007 - 2009 With manual air conditioning system

Interior blower not working

If the interior blower fails in one of the vehicles listed above, this may be caused by a faulty plug connection on the series resistor.

Vehicles with a manual air conditioning system and the following chassis number:

up to W0L0SDL6894298980 (Zaragoza plant) up to W0L0SDL0896118216 (Eisenach plant)

Proceed as follows to rectify the problem:

- Take out the glove box
- Remove the air duct in the footwell
- Take the plug off the series resistor
- Check the plug using a mirror
- If the plug is damaged:
 Replace the series resistor and use a repair plug set (both available from the authorized dealer)
- Perform functional test
- Install air duct and glove box

