



Opel Meriva model year 2003-2004 with engines Z16XE | Z16SE

Engine electrics warning light illuminates

If there are complaints about the above-mentioned fault, fuse F 15 could be the cause. In addition, the fault codes P1500 and P1550 A+B (throttle valve actuator failure) are stored in the fault memory, and the engine control switches to emergency running. A loose contact at fuse F 15 causes a brief interruption of the voltage supply of the engine control unit.

In this case, the fuse must be removed and the slot must be checked for any damage and soiling, and, if necessary, it must be repaired. The fault memory must be deleted following the repair.

Bulletin

