



Opel Movano 2000 – 2002 1.9 DI engine (F9Q)

Engine loses power, engine check lights illuminate.

If there are complaints with these vehicles that the engine is losing power and the engine check light illuminates, one possible cause could be that the fuel pump start is set wrongly.

To eliminate the fault, the fuel pump start must be readjusted with the aid of a dial gauge.

Setting value: 0.32 +/- 0.02 mm

To find out if there any other sources for the fault, a read out of the fault memory should be taken and the fuel system checked.

