



Opel Omega B All models with climate control

Difference between the set temperature and the interior temperature.

On this vehicle it is possible that the set temperature on the display is different to the interior temperature. This is caused by the interior temperature sensor. The sensor is touching the bracket housing. Due to this, the measurement is incorrect. To rectify the problem the sensor must be moved away by bending carefully. To do this, insert a thin object through the slots of the climate control panel, into the middle of the housing and move the sensor away from the housing.



Bulletin