



Opel Omega-B buildyear 1994 Sintra buildyear 1997 with engine X25XE, X30XE

Engine runs bad, rough idling, drop off power brake assistance.

If on this vehicle the problem is a badly running engine, a rough idling and a lack of power brake assistance, a possible cause could be a leak between the EGR valve adapter and the intake plenum. Due to the strong shrinking of the seal the three mounting screws are loosen. To rectify the problem, the screws must be retighten with a torque of **8 Nm**. It is not necessary to renew the seal.

After the retightening of the screws the engine should be warmed up to operating temperature and cooled down.

Check again the torque of 8 Nm of the screws.

Bulletin

