

© Hella KGaA Hueck & Co., Lippstadt 29 January 2008 1-2

Opel Omega B From model year 1998

Airbag control lamp illuminates

If there are complaints about the above-mentioned fault, the cause could be excessive contact resistance in the plug-connections between the airbag module, seat harness and body harness. The manufacturer offers a repair kit for this case. Proceed as follows:

- Disconnect the battery and wait for five minutes until the capacitors have discharged.
- Disconnect the plug-connections of the front seat.
 Remove the front seat.
- Remove the insulating tape from the body harness.
- Cut off the body harness a good 10cm (measure to the rear from the plug).
- Strip the insulation from the cable ends of the harness and slide on the insulating splices and thermal contraction hose.

Observe the correct polarity between the body harness and the repair harness! The plug of the repair kit has the colours brown and blue. **Connection: brown-brown, blue-white.**

- Crimp the cables and then seal using the thermal contraction hose.
- Wrap insulating tape around the body harness and then re-affix correctly.
- Remove the seat-back cover/upholstery.





Bulletin



© Hella KGaA Hueck & Co., Lippstadt 29 January 2008 2-2

- Unlock the plug-connection of the side airbag and disconnect.
- Remove the old harness from the side airbag.
- Connect the plug of the repair harness to the airbag unit and lock.
- Lay the new harness properly and fasten using clips.
- Refasten the seat-back cover/upholstery.
- Refit the front seat.
- Connect the plug of the airbag harness to the harness of the seat.
- Connect the cable plug of the seat to the plug of the body harness.
- Reconnect the battery.
- Delete the fault memory.

