



Opel Signum / Vectra C Model year: 2004 - 2005 Engine: Y30DT

Parking heater cable harness causes problems on the low speed bus

With the above-mentioned vehicles, there can be problems from time to time with the low speed bus and all the control units connected to this. The following fault codes can occur: B0438...B0488; U1500; U2100; U2174. The cause could be a damaged parking heater cable harness. This cable harness sometimes frays against the coolant pump bracket, which can problems on the low speed bus. To remedy the problem, the cable harness should be checked and damaged spots repaired, insulated and fixed in place again. For this to be carried out correctly, the parking heater might have to be removed. After repairs have been completed, the fault memory entries should be deleted.

From vehicles with VIN: W0L0ZCF4851069798, the cable harness was modified in the factory so that vehicles from this VIN onwards should no longer be affected by the problem.

Bulletin