



## **Opel Vectra-C Model year from 2003 to 2005 All vehicles with adaptive running light**

### **Control lamp for lighting illuminates.**

If there are complaints about the above-mentioned fault, the cause could be a faulty power module. In addition, fault codes B1461 and B1462 may be stored. This fault occurs mainly when driving on poor roads. Therefore, the customer should be asked about this. When troubleshooting, the fault can be simulated relatively easily. First, delete the fault memory and then drive the vehicle along a poor road. Depending on the quality of the road, the fault will be displayed after a short period. If this is the case, the affected power module on the headlight must be replaced. As the module is fitted on the underside of the headlight (see illustration), the headlight must be removed in order to carry out the repair.

A new module was used from vehicle identification no.:  
W0L0ZCF6851100331.

