



## **Opel Vivaro**

### **Model year: May 2006 to April 2007**

#### **Engine misfires / engine does not start / engine overheats; functional problems with headlights / reverse lights**

With some of the above-mentioned vehicles, faulty attachment of the dashboard cable harness can lead to different problems with engine management and/or lighting. The cable harness can rub near the steering column and/or at the clutch sensor's impact protection. This can cause the following faulty functions:

- Engine misfires
- Engine does not start
- Engine overheats
- Faulty headlight function
- Faulty reverse light function

To remedy the problem, the cable harness should be checked, repaired and fixed in place again. If necessary, the cable harness must be replaced, which involves a considerable amount of work, however.

The vehicle manufacturer is already working on the problem and has notified the owners of the vehicles concerned. It can be assumed, however, that not all vehicles are checked or improved for various reasons.