



## **Opel Vivaro** **Model year 2001 - 2003**

### **Failure of the windscreen wiper motor, fuse FC 15 blown.**

If there are complaints with these vehicles that the windscreen wiper motor does not work and that the fuse FC 15 is blown, one possible cause is fuse overload.

This fault only occurs during the cold months when the windscreen wipers freeze to the windscreen. When the windscreen wipers are switched on, the current consumed by the wiper motor increases to such a great extent that the 25 A fuse blows. To eliminate the fault the fuse can be replaced by a more powerful 30 A fuse. In this case no changes are necessary to the wiring harness.

#### Note:

From March 2003 a modified wiring harness with a more powerful fuse has been used by the manufacturer.

**Bulletin**

