



Opel Zafira 2.0 DI 16V From model year 10/1999

Bulb replacement Dipped beam, right

The bulb (H7) for the right-hand dipped beam light in this vehicle is difficult to access. In order to prevent damage and impurities on the glass bulb, the following procedure should be followed during bulb replacement:

- Disconnect the plug from the mass air flow meter (Photo 1 / item 1) (loosen the catch from below).
- Remove the vent pipe from the valve cover (Photo 1 / item 2)
- Remove the pipe connection on the turbocharger (Photo 1 / item 3)
- Loosen the 4 attachment clips from the top part of the air filter housing
- Remove top part of the air filter housing
- Remove bottom part of the air filter housing by removing the screw
- Remove the indicator bulb with its holder (Photo 2 / item 1)
- Loosen the H7 bulb of the dipped beam light with socket by turning it 45° anti-clockwise and lifting it out (Photo 2 / item 2)

Installation is in reverse order to removal

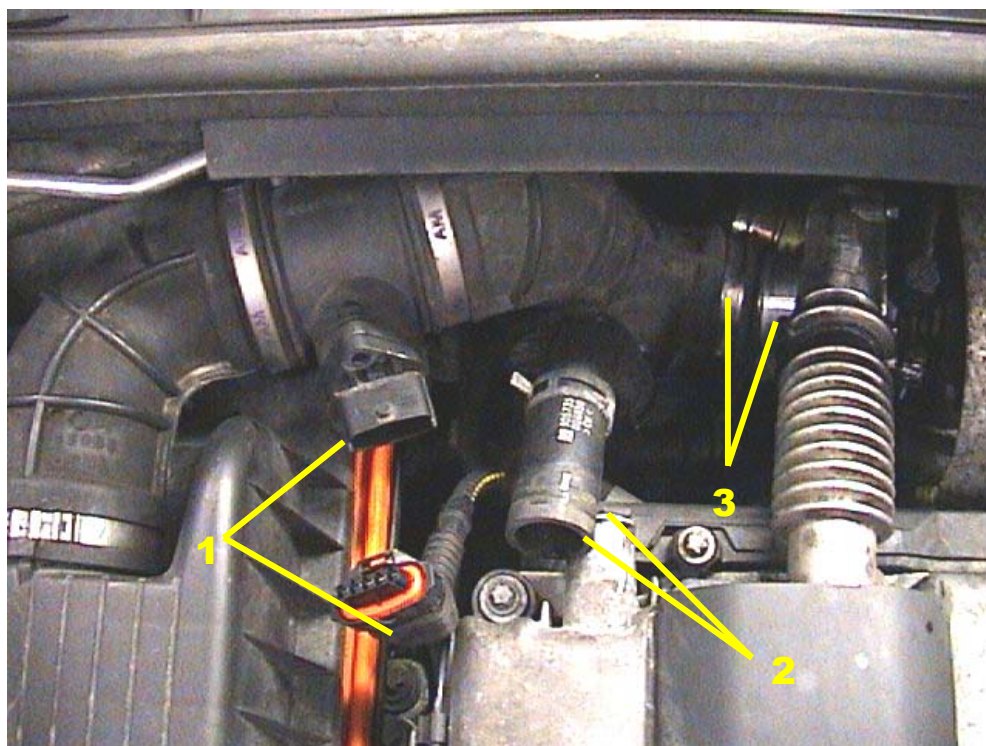


Photo 1

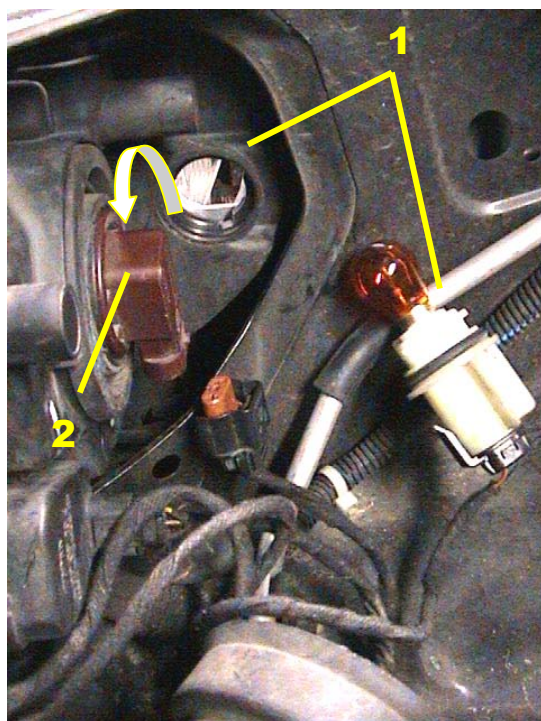


Photo 2