



Renault Laguna (B56)

Noises from the dashboard

With the above-mentioned vehicles, there can be clicking noises from the dashboard. These could be caused by a plastic stop on the recirculated air flap being bent. To localise the fault proceed as follows:

- Remove the glove compartment
- Disconnect the battery and reconnect it (setting motor(s) will be switched on again)
- Note any noises

If the stop on the recirculated air flap is bent, a noise will be heard before the setting motor switches off. In this case the housing for the supply air should be replaced by a modified version. Whether or not a modified part has already been installed can be determined on the basis of the date of manufacture. If the date is higher than 129.95 for left-hand drive cars (LHD) or 142.95 for right-hand drive cars (RHD) a modified housing with reinforced stops has already been installed. The date can be found on a sticker on the housing. In some cases the noise can also originate from the flap setting motor itself.

Please note that the radio code could have to be re-entered after the battery has been reconnected and some systems could have to be re-taught.

Bulletin