Bulletin



© Behr Hella Service GmbH, Schwäbisch Hall 4 September 2007 1-1

Renault Laguna 2 Model year: from 2001 Engine: 1.8 i

Compressor not working

If, in the case of the above-mentioned vehicles, the air-conditioning compressor no longer switches on, the cause may be related to a defective plug-connection on the pressure sensor. When troubleshooting, in particular if fault codes such as "Air-conditioning system does not produce any pressure" are stored, the plug-connection on the pressure sensor should be checked with regard to corrosion, water ingress and loose connections. Due to the somewhat unfavourable installation position (in the lower area on the condenser) of the plug/sensor, water can penetrate and lead to corrosion. If necessary, the plug, including the plug-contacts must be cleaned and dried. When doing so, ensure that the plug-contacts in the plug-housing have not pushed backwards or become stuck.



