




Renault Megane I **Model year: 1996 – 2002** **With air conditioning system**


Noises in recirculation mode

If with these above-mentioned vehicles noises occur in the dashboard area in recirculation mode, the cause could be damaged teeth on the drive pinion of the recirculation flap. A break in the mechanical stop can damage the teeth on the drive pinion. To eliminate the problem, the recirculation flap and drive pinion have to be replaced.

In addition, a new mechanical stop has to be self-made from a metal plate 2 mm thick and 10 mm wide (see drawing 1). The mechanical stop is attached to the housing of the recirculation flap using two rivets (drawing 2). There is quite a considerable amount of work involved, exactly how much depends on the engine version.

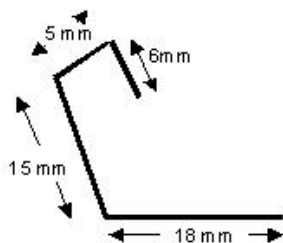

Drawing 1

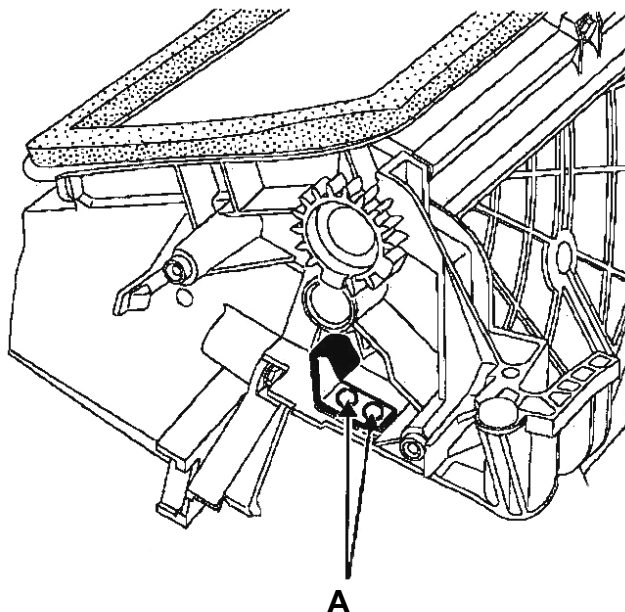

Drawing 2

Bulletin