



Renault Megane II + Scenic II Model year: from 2002 Engine: all

Air-conditioning not working

If the air-conditioning system in the above-mentioned vehicles is no longer working and there is no fault stored in the memory of the air-conditioning control unit, this could be caused by too little refrigerant being in the system.

When the air-conditioning system is “not full enough” the compressor is switched off via the engine control unit with the aid of the refrigerant pressure sensor.

When the filling quantity is too low, the fault code 1328 (refrigerant pressure sensor, faulty function) is stored in the engine control unit, and/or code 1332 (pressure/temperature sensor air-conditioning system faulty).

To remedy the situation, the air-conditioning system must be filled with the correct quantity of refrigerant again after the fault has been eliminated, and the fault memory of the engine control unit must be deleted.

Please bear the information in mind if there are complaints about the air-conditioning system. This information may also be applicable for other vehicle types.