



Rover 45

All models from model year 1999

Engine misfires and/or poor throttle response.

If there are complaints with these vehicles that the engine misfires and/or shows a poor throttle response, one possible cause is a damaged cable to the ignition coils. Faulty installation of the upper engine cover (above the ignition coils) jams and damages the cable to the ignition coils. To eliminate the fault proceed as follows:

- Remove the upper engine cover.
- Check the cable connection to the ignition coils for damage in the area where it is routed under the cover.
- Repair damaged spots or renew the cable strand if necessary.
- Route the cable properly and make sure repeated damage cannot occur.
- Replace the upper engine cover.

Bulletin

