



Rover 75

Air-conditioning system not working after repairs

With the above-mentioned vehicles, it is possible that the air-conditioning system no longer switches on after the front bumper has been removed and then remounted. This can be the case after condenser replacement, for example. In order to remove the bumper, a central plug has to be loosened; the connections for the exterior temperature sensor are integrated in this plug. The temperature sensor is on the right-hand side of the bumper underneath the right-hand headlight. When the central plug is re-inserted, the sensor is in a "non-calibrated" state. The display indicates an exterior temperature of -29 °C and the air-conditioning system does not switch on. The only possibility of calibrating the sensor and "activating" the air-conditioning system is to drive the vehicle until a correct exterior temperature is indicated. This usually takes a few kilometres.

Bulletin