



Rover 75

Chassis No.: RJ100001 to RJ106487

Refrigerant loss due to damaged high pressure hose

Damage to the hose between the compressor and condenser can lead to refrigerant loss on the vehicles specified above. Particularly on models with 1.8 litre engine, the original hose can be routed too close to the V-belt pulley resulting in damage. The distance between the hose and pulley should be at least 10 mm. Replace defective or chafed hoses with modified hose version. As of chassis No. RJ106487 the modified hoses are already installed at the factory.

Installation Tips:

- To view the hose remove the bottom engine protection plate.
To replace the hose, remove the radiator grille, air baffles and horn on the left. Loosen bolts fastening hose to condenser through horn opening.

Blitz-Info