



Saab 9-5 till chassis number W3087635 or X3005081

Faulty ground/earth contact

If, on this vehicle the left headlamp, headlamp relay, headlamp wiper, horn, cooling fan, fan relay, washer pump and level indicator have a malfunction or are functionless, a possible cause could be a faulty ground/earth connection. This ground/earth connection (G 30) is located in the engine bay in front of the left wheel housing. It is possible that the insulation is trapped under the ground/earth connection. To rectify the problem, loosen the ground/earth connection, clean and retighten ensuring the insulation is not trapped.

Bulletin

