



Saab 9-5

All models

Rear of vehicle poorly heated.

If there are complaints with these vehicles that the rear of the vehicle is poorly heated, one possible cause is the air-distribution flaps being incorrectly adjusted. In order to eliminate the fault, the setting of the lower flap in the heater housing must be checked and, if necessary, corrected. To do this, proceed as follows:

- Start the engine, set the temperature control to cold.
- Let the engine run for at least 20 seconds.
- Switch off the engine and switch off the ignition.
- Remove the panelling of the centre console on the passenger side.
- Remove the cover from the lower flap control and unhook the connection brace.
- Using a feeler gauge, set the adjusting lever to a distance of 2 mm to the stop.
- First set the connection brace to the appropriate length, if necessary, and hook into place again.
- Refit the cover and the panelling.
- Check that the heating and flap control work properly.

Bulletin