



Skoda Felicia All models with 1.3-litre engine

Poor engine idling, engine cuts out when idling, no throttle response.

If there are complaints with these vehicles about the above-mentioned faults, one possible cause is heavy contamination of the electronic throttle housing. Oil deposits in the area of the throttle blade mean that values in relation to idle control saved in the engine control unit can no longer be adjusted. In order to eliminate the fault, the throttle housing can be cleaned. Replacement of the throttle housing is recommended, however, as damage may occur during the cleaning process. It is important that both after cleaning or replacement, the throttle housing is adapted to the engine control unit using suitable diagnosis equipment. If this is not done, perfect engine running cannot be guaranteed.

Bulletin