



## **Skoda Octavia 1.8 RS, engine code AUQ Model year 2001–2004**

### **Sporadic loss of performance in the partial-throttle range**

In the case of a Skoda Octavia with the engine code AUQ, it was found that the engine control unit sporadically switched over to limp-home mode after a sporadic loss of performance in the partial-throttle range.

Checking the fault memory revealed fault code 17705 – *turbocharger / throttle blade – hose connection – loss of pressure.*

If after checking the hose connections these can be excluded as a cause, the reason for the sporadic loss of performance is often the electropneumatic change-over device of the boost-pressure control.

To rectify the fault, replacement of the change-over device, followed by deletion of the fault memory are required.

