



MCC Smart All engines

Engine cannot be started.

If on these vehicles the fault occurs that all the warning lights in the instrument cluster illuminate but the vehicle cannot be started, the reason could be that the immobiliser is not being deactivated.

This fault is caused by an incorrectly seated fuse. Impact and vibration can loosen the 7.5 A fuse (no. 15 in the fuse box on the left in the footwell) for the instrument cluster such that the fuse no longer sits in the holder properly. This is difficult to determine during a visual inspection since the fuse is only slightly at an angle in the holder.

To eliminate the fault and prevent it happening repeatedly, the fuse contact lugs should be twisted slightly and the fuse inserted properly again.

Bulletin

